

High precision quality.

Car
Division



GB

febiEXAKT




Windscreen wiper motor

febi no. 22688

Repl. No. 202 820 23 08

fits

Mercedes-Benz C-Class (W202)

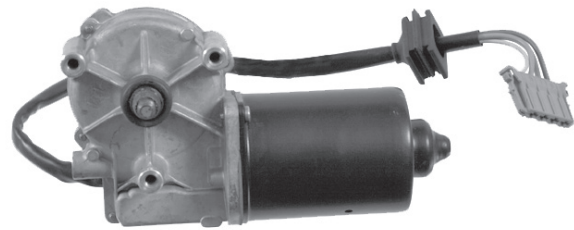

>> PROBLEM:

The windscreen wiper motor is noisy, cuts out intermittently or fails completely during operational use.



>> CAUSE:

The windscreen wiper motor operates linkages and a lifting mechanism for driving the windscreen wiper arm (see photos 1 and 2). These components may become stiff due to external factors.

The toothed wheel of the motor is made of plastic and can easily become damaged (see photos 3 and 4). If the toothed plastic wheel is faulty, the worm gear will no longer operate the toothed wheel to the full extent. This means that the windscreen wiper no longer works properly, makes a noise and/or fails to function completely.

>> SOLUTION:

febi bilstein recommends checking linkages and lifting pistons for freedom of movement prior to fitting windscreen wiper motor febi 22688. This may prevent the windscreen wiper motor from failing prematurely.

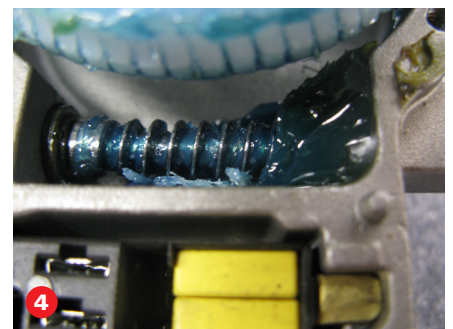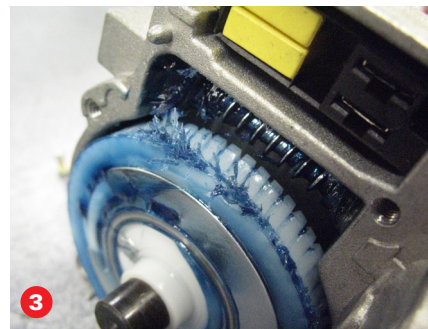

Subject to technical changes

febi North America Corp.

P.O. Box 329 | Valley Ford, CA 94972-0329 | USA

Tel. +1-707-665 98 42

Toll free +1-800-798-febi (3324)

Fax +1-707-665 97 52

E-mail febi@comcast.net

Vehicle repairs. We've got what it takes.™

www.febi.com

